


SIT-LOCK® 15 - Self-Centering

Suitable for servomotors and small pulleys. It gives an axial force, similar to the clamp load of the screws, and an axial movement

that can be used to set ball bearings.

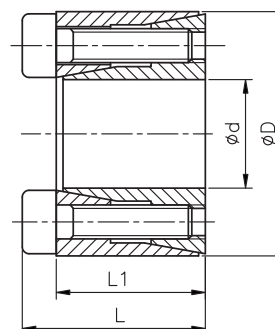

Installation

Carefully clean contact surfaces of shaft and hub. Then, lightly oil both surfaces with standard mineral oil. Position the SIT-LOCK® on the shaft and into the hub machined bore. Align them as required by the application. Gradually and uniformly tighten the locking screws to the tightening torque (Ms).

You must tighten the screws in diametrically opposite sequence in stages:

- hand tighten the screws until the surfaces are in contact

- carefully check the position of the hub on the shaft
- tighten the screws to half the value of the tightening torque (Ms) stated in the catalogue
- repeat the operation until the tightening torque is reached using the dynamometric screw-driver
- check every locking screw to insure it has been tightened to the specific tightening torque

Do not use lubricant like "Molykote" or molybdenum disulfide based oils.

Removal

Gradually loosen the clamping screws. Transfer the screws into the releasing tapped holes and tighten them until the front cone is released. Loosen the clamping screws again. Transfer the clamping screws into the releasing holes of the intermediate ring, and tighten them until the back cone is released.

Note: To reuse the locking element, carefully oil the screws and the conical surfaces, then follow installation instructions.

Concentricity

For self-centering locking assemblies, the clamping element has a centering effect and the concentricity error can be considered 0.02-0.04 mm.

Maximum allowable roughness
Rt 16 μ m
Maximum recommended tolerance
shaft h 8 - hub H 8

SIT-LOCK® 15

Dimensions [mm]					Performances		Pressure [N/mm ²]		Clamping screws (DIN 912 - 12,9)		
d x D	d	D	L	L ₁	M _T [Nm]	F _{ax} [kN]	p _w	p _n	N°	Type	M _s [Nm]
5 x 16	5	16	13,5	11	7	3	190	60	3	M2,5 x 10	1,2
6 x 16	6	16	13,5	11	9	3	160	60	3	M2,5 x 10	1,2
6,35 x 16	6,35	16	13,5	11	9	3	150	60	3	M2,5 x 10	1,2
7 x 17	7	17	13,5	11	10	3	140	60	3	M2,5 x 10	1,2
8 x 18	8	18	13,5	11	11	3	120	55	3	M2,5 x 10	1,2
9 x 20	9	20	15,0	13	17	3	120	55	4	M2,5 x 12	1,2
9,53 x 20	9,53	20	15,0	13	17	3	115	55	4	M2,5 x 12	1,2
10 x 20	10	20	15,5	13	19	3	110	55	4	M2,5 x 12	1,2
11 x 22	11	22	15,5	13	21	3	100	50	4	M2,5 x 12	1,2
12 x 22	12	22	15,5	13	23	3	90	50	4	M2,5 x 12	1,2
14 x 26	14	26	20,0	17	40	6	95	50	4	M3 x 16	2,1
15 x 28	15	28	20,0	17	43	6	90	50	4	M3 x 16	2,1
16 x 32	16	32	21,0	17	80	10	150	70	4	M4 x 16	4,9
17 x 35	17	35	25,0	21	85	10	110	55	4	M4 x 20	4,9
18 x 35	18	35	25,0	21	90	10	105	55	4	M4 x 20	4,9
19 x 35	19	35	25,0	21	95	10	100	55	4	M4 x 20	4,9
20 x 38	20	38	26,0	21	165	16	155	80	4	M5 x 20	10
22 x 40	22	40	26,0	21	180	16	140	75	4	M5 x 20	10
24 x 47	24	47	32,0	26	280	23	145	75	4	M6 x 24	17
25 x 47	25	47	32,0	26	290	23	140	75	4	M6 x 24	17
28 x 50	28	50	32,0	26	485	35	180	100	6	M6 x 24	17
30 x 55	30	55	32,0	26	520	35	170	95	6	M6 x 24	17
32 x 55	32	55	32,0	26	555	35	165	95	6	M6 x 24	17
35 x 60	35	60	37,0	31	810	46	170	100	8	M6 x 28	17
38 x 65	38	65	37,0	31	880	46	155	90	8	M6 x 28	17
40 x 65	40	65	37,0	31	925	46	150	90	8	M6 x 28	17
42 x 75	42	75	44,0	36	1350	64	170	95	6	M8 x 34	41
45 x 75	45	75	44,0	36	1450	64	160	95	6	M8 x 34	41
48 x 80	48	80	44,0	36	2050	85	190	110	8	M8 x 34	41
50 x 80	50	80	44,0	36	2140	85	190	110	8	M8 x 34	41

Notes:

Dimensions representing the total length of the hub are indicative; they are calculated according to the geometric rules.

M _S	Screw tightening torque	Nm
M _T	Transmissible torque moment	Nm
F _{ax}	Transmissible axial load	N
p _w	Shaft pressure	N/mm ²
p _n	Hub pressure	N/mm ²


Design of hub outside minimum diameter

When using the locking units, the shaft-hub connection is characterized by a pressure on the hub surface, which is exerted by the locking unit outer ring when the clamping screws are tightened to the stated value. It is important to design correctly the hub outside diameter. The following table summarizes the procedure as a simple calculation. To determine the hub outside minimum

diameter, simply multiply the factor K by the SIT-LOCK® outside diameter to obtain the hub outside minimum diameter. The factor K varies depending on the yield limit of hub material, the hub surface pressure (Pn) and the factor (x), variable according to the application type (A, B, C).


Installation type A

X = 1

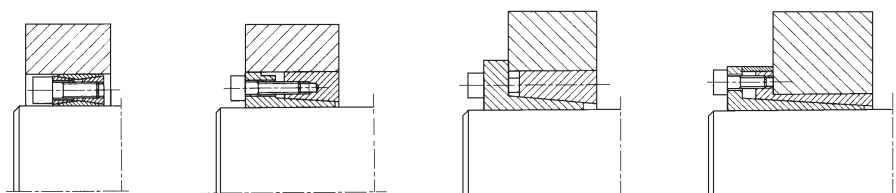


Installation type B

X = 0,8

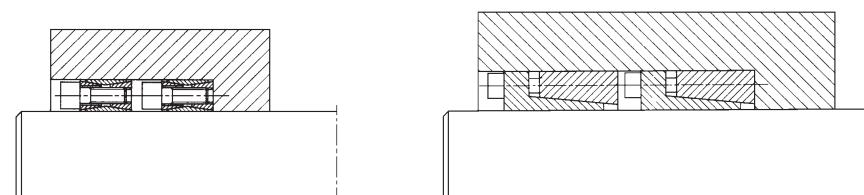

Installation type C

X = 0,6

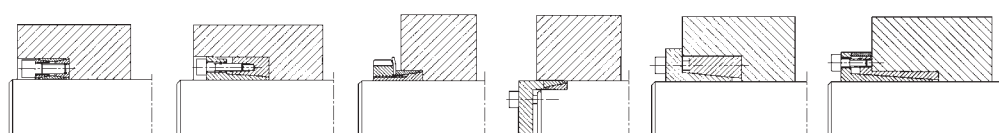

Hub min diameter $D \times K$

for: K = factor stated in the table
D = SIT-LOCK® outside diameter

Hollow shaft

For application with locking-assemblies on hollow shaft, it is important to scale both hub minimum diameter and hollow

shaft diameter. Contact our Technical Department for design.

Coefficient K

Hub surface pressure		Yield limit of hub material σ_{02} [N/mm ²]										
		150	180	200	220	250	270	300	350	400	450	600
		Hub material										
p_n [N/mm ²]	Application	GG 20	GG 25 GS 38	GG 30 GTS 35	GS 45 ST 37-2	GG 40 GS 52	ST 50-2 C 35	GG 50 GS 60 ST 60-2	GG 60 GS 62 ST 70-2	GG 70 GS 70 C 60	Heat treatment steel	
60	C	1,29	1,26	1,21	1,19	1,16	1,15	1,13	1,11	1,10	1,09	1,07
	B	1,40	1,31	1,25	1,24	1,23	1,21	1,19	1,16	1,13	1,12	1,09
	A	1,53	1,43	1,37	1,33	1,29	1,26	1,23	1,19	1,17	1,15	1,11
65	C	1,31	1,26	1,23	1,21	1,19	1,16	1,14	1,12	1,11	1,10	1,08
	B	1,45	1,36	1,31	1,29	1,25	1,23	1,21	1,17	1,15	1,13	1,10
	A	1,61	1,46	1,41	1,36	1,31	1,29	1,25	1,21	1,19	1,17	1,13
70	C	1,35	1,27	1,25	1,23	1,19	1,17	1,16	1,13	1,12	1,11	1,08
	B	1,49	1,39	1,35	1,31	1,26	1,24	1,21	1,19	1,16	1,14	1,11
	A	1,66	1,51	1,46	1,41	1,35	1,31	1,26	1,23	1,21	1,18	1,14
75	C	1,31	1,29	1,26	1,24	1,21	1,19	1,16	1,15	1,13	1,12	1,09
	B	1,53	1,43	1,37	1,33	1,29	1,26	1,23	1,19	1,17	1,15	1,12
	A	1,75	1,56	1,49	1,43	1,37	1,34	1,31	1,26	1,21	1,19	1,14
80	C	1,40	1,32	1,29	1,26	1,22	1,21	1,19	1,16	1,14	1,12	1,09
	B	1,59	1,46	1,40	1,36	1,31	1,28	1,25	1,21	1,19	1,16	1,12
	A	1,82	1,62	1,54	1,47	1,40	1,37	1,32	1,27	1,23	1,21	1,15
85	C	1,43	1,35	1,31	1,28	1,24	1,22	1,20	1,17	1,15	1,13	1,10
	B	1,64	1,50	1,43	1,39	1,33	1,30	1,27	1,23	1,20	1,17	1,13
	A	1,91	1,68	1,58	1,51	1,43	1,40	1,35	1,29	1,25	1,22	1,16
90	C	1,47	1,37	1,33	1,29	1,26	1,23	1,21	1,18	1,16	1,14	1,10
	B	1,70	1,54	1,47	1,41	1,35	1,32	1,29	1,24	1,21	1,19	1,14
	A	2,01	1,74	1,63	1,55	1,47	1,42	1,37	1,31	1,27	1,23	1,17
95	C	1,50	1,40	1,35	1,31	1,27	1,25	1,22	1,19	1,16	1,15	1,11
	B	1,76	1,58	1,50	1,44	1,38	1,35	1,31	1,26	1,22	1,20	1,15
	A	2,12	1,81	1,69	1,60	1,50	1,45	1,40	1,33	1,28	1,25	1,18
100	C	1,54	1,42	1,37	1,33	1,29	1,26	1,23	1,20	1,17	1,15	1,12
	B	1,82	1,62	1,54	1,47	1,40	1,37	1,32	1,27	1,23	1,21	1,15
	A	2,25	1,88	1,74	1,64	1,54	1,49	1,42	1,35	1,30	1,26	1,19
105	C	1,57	1,45	1,40	1,35	1,30	1,28	1,25	1,21	1,18	1,16	1,12
	B	1,89	1,67	1,57	1,51	1,43	1,39	1,34	1,29	1,25	1,22	1,16
	A	2,39	1,96	1,80	1,69	1,57	1,52	1,45	1,37	1,32	1,28	1,20
110	C	1,61	1,48	1,42	1,37	1,32	1,29	1,26	1,22	1,19	1,17	1,13
	B	1,97	1,72	1,61	1,54	1,45	1,41	1,36	1,30	1,26	1,23	1,17
	A	2,56	2,05	1,87	1,74	1,61	1,55	1,48	1,39	1,34	1,29	1,21
115	C	1,65	1,51	1,44	1,37	1,34	1,31	1,27	1,23	1,20	1,18	1,13
	B	2,05	1,77	1,65	1,57	1,48	1,44	1,38	1,32	1,27	1,24	1,18
	A	2,76	2,14	1,94	1,80	1,65	1,59	1,51	1,42	1,35	1,31	1,22
120	C	1,70	1,54	1,47	1,40	1,35	1,32	1,29	1,24	1,21	1,19	1,14
	B	2,14	1,82	1,70	1,61	1,51	1,46	1,40	1,34	1,29	1,25	1,19
	A	3,01	2,25	2,01	1,85	1,70	1,62	1,54	1,44	1,37	1,32	1,23
125	C	1,74	1,57	1,49	1,44	1,37	1,34	1,30	1,25	1,22	1,19	1,14
	B	2,25	1,88	1,74	1,64	1,54	1,49	1,42	1,35	1,30	1,26	1,19
	A	3,33	2,36	2,09	1,92	1,74	1,66	1,57	1,46	1,39	1,34	1,25
130	C	1,79	1,60	1,52	1,46	1,39	1,36	1,31	1,26	1,23	1,20	1,15
	B	2,36	1,94	1,79	1,68	1,57	1,51	1,45	1,37	1,31	1,28	1,20
	A	3,75	2,50	2,18	1,98	1,79	1,70	1,60	1,49	1,41	1,36	1,26
135	C	1,84	1,62	1,55	1,48	1,41	1,37	1,33	1,28	1,24	1,21	1,16
	B	2,49	2,01	1,84	1,72	1,60	1,54	1,47	1,39	1,33	1,29	1,21
	A	4,37	2,66	2,28	2,05	1,84	1,74	1,63	1,51	1,43	1,37	1,27
140	C	1,89	1,67	1,57	1,51	1,43	1,39	1,34	1,29	1,25	1,22	1,16
	B	2,64	2,08	1,89	1,76	1,63	1,55	1,49	1,40	1,34	1,30	1,22
	A	5,40	2,84	2,39	2,13	1,89	1,79	1,67	1,54	1,45	1,39	1,28
145	C	1,95	1,70	1,60	1,53	1,45	1,41	1,36	1,30	1,26	1,23	1,17
	B	2,81	2,16	1,95	1,81	1,66	1,59	1,51	1,42	1,36	1,31	1,23
	A	7,67	3,06	2,51	2,22	1,95	1,83	1,70	1,56	1,47	1,41	1,29
150	C	2,01	1,74	1,63	1,55	1,47	1,42	1,37	1,31	1,27	1,24	1,17
	B	3,01	2,25	2,01	1,85	1,70	1,62	1,54	1,44	1,37	1,32	1,24
	A	—	3,33	2,66	2,31	2,01	1,88	1,74	1,59	1,49	1,42	1,30
155	C	2,07	1,78	1,66	1,58	1,49	1,44	1,39	1,32	1,28	1,25	1,18
	B	3,26	2,34	2,07	1,90	1,73	1,66	1,56	1,46	1,39	1,34	1,24
	A	—	3,67	2,81	2,41	2,07	1,93	1,78	1,62	1,52	1,44	1,31
160	C	2,14	1,82	1,70	1,61	1,51	1,46	1,40	1,34	1,29	1,25	1,19
	B	3,56	2,44	2,14	1,95	1,77	1,68	1,59	1,48	1,40	1,35	1,25
	A	—	4,13	3,01	2,53	2,14	1,99	1,82	1,65	1,54	1,48	1,32
165	C	2,22	1,87	1,73	1,63	1,53	1,48	1,42	1,35	1,30	1,26	1,19
	B	3,97	2,56	2,22	2,01	1,81	1,72	1,61	1,50	1,42	1,36	1,26
	A	—	4,81	3,24	2,66	2,22	2,05	1,87	1,68	1,56	1,48	1,34

Note: p_n is stated in the dimensional table of each of the locking assemblies. Installation type (A, B, C) are stated in the previous page.